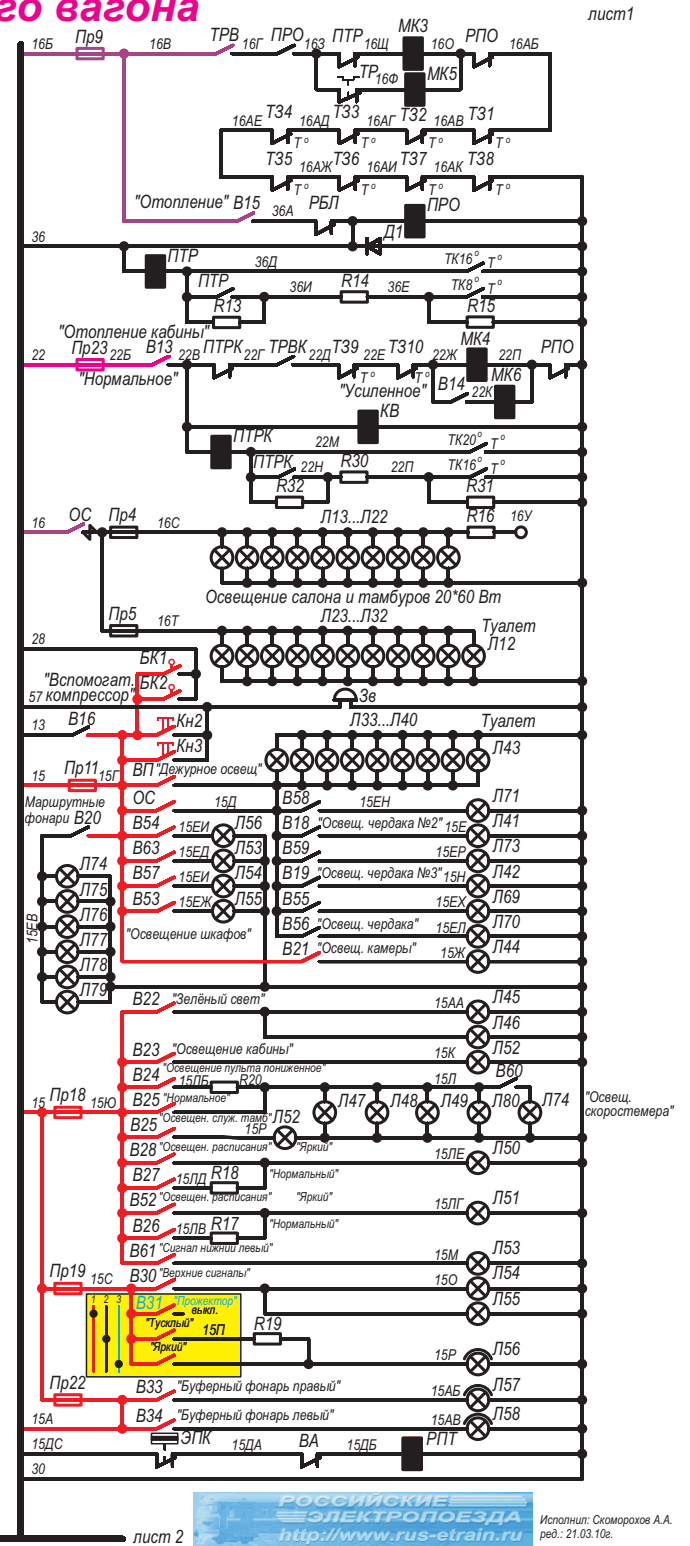
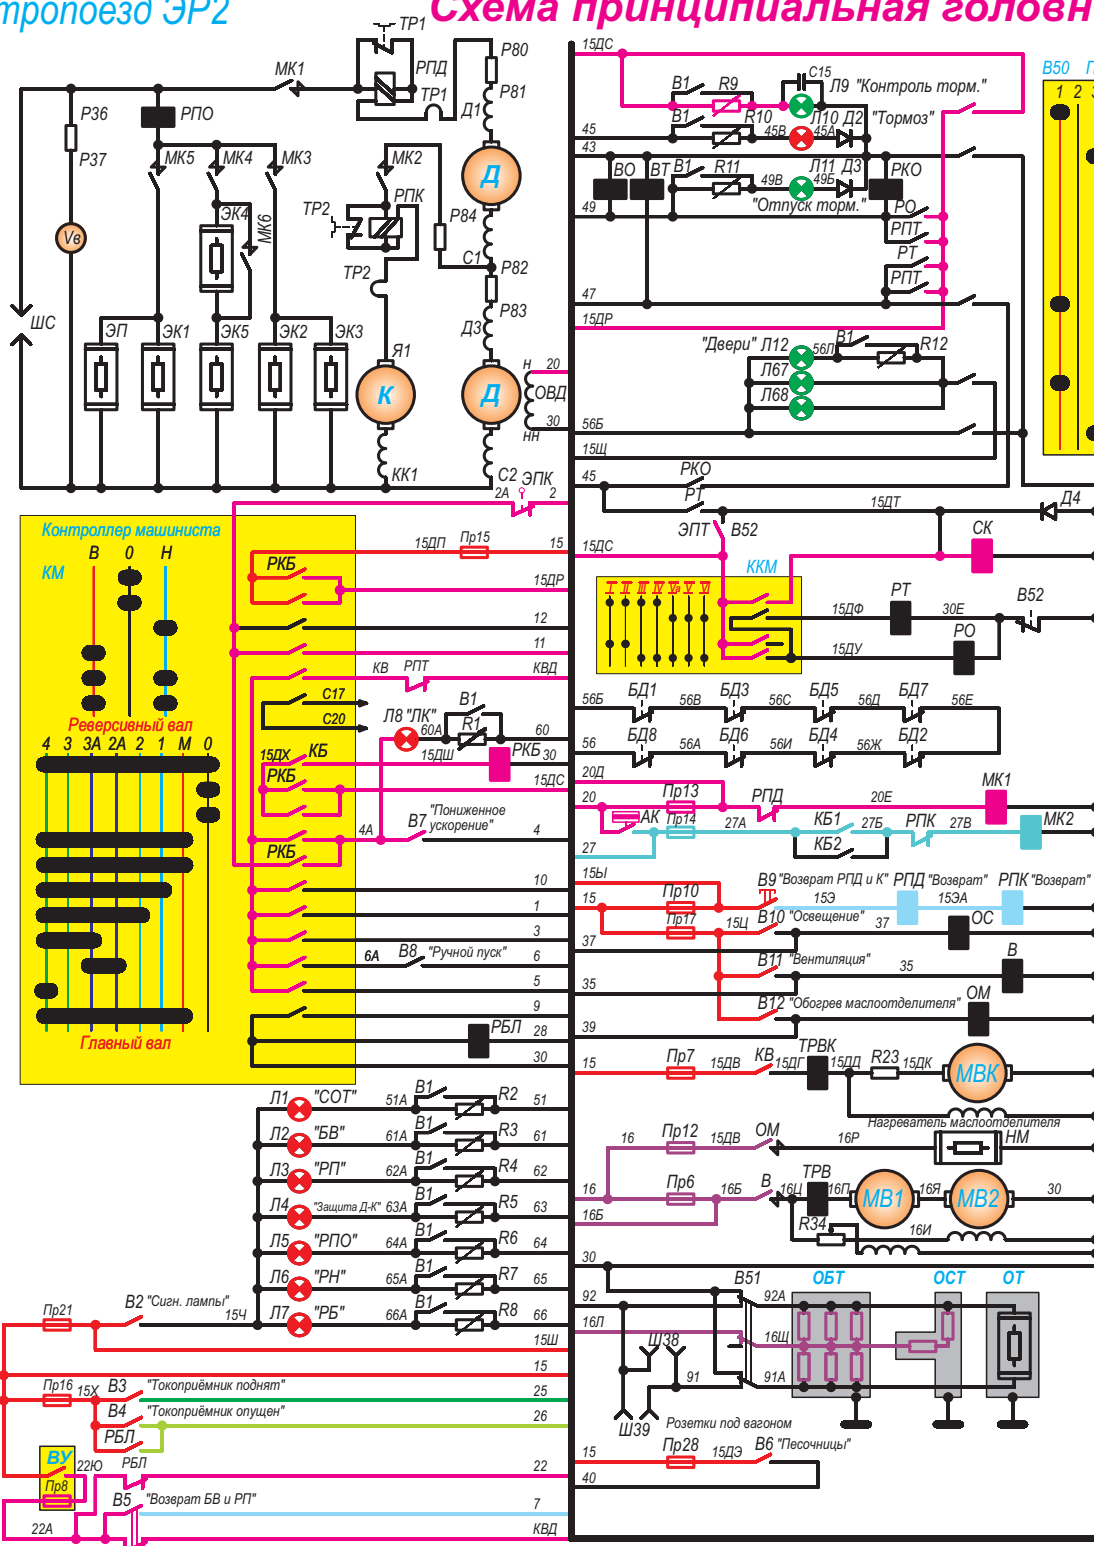
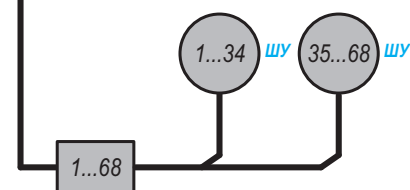
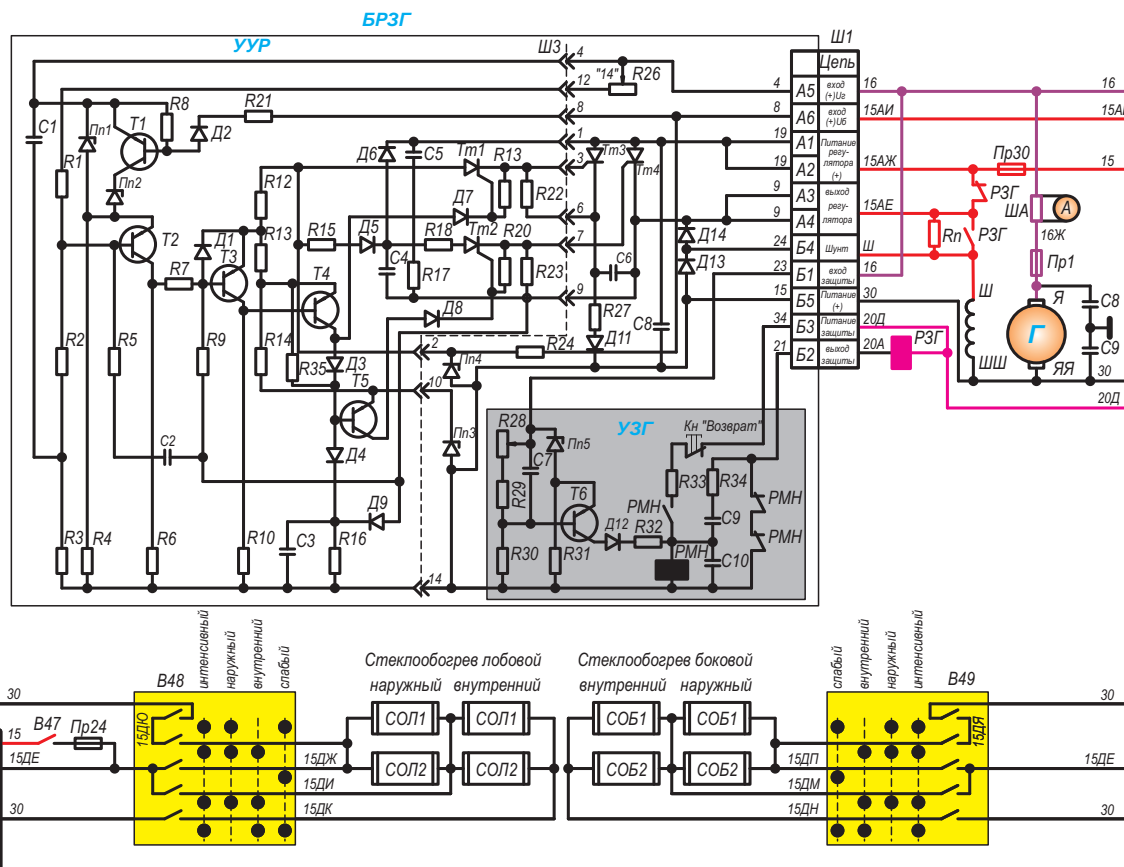
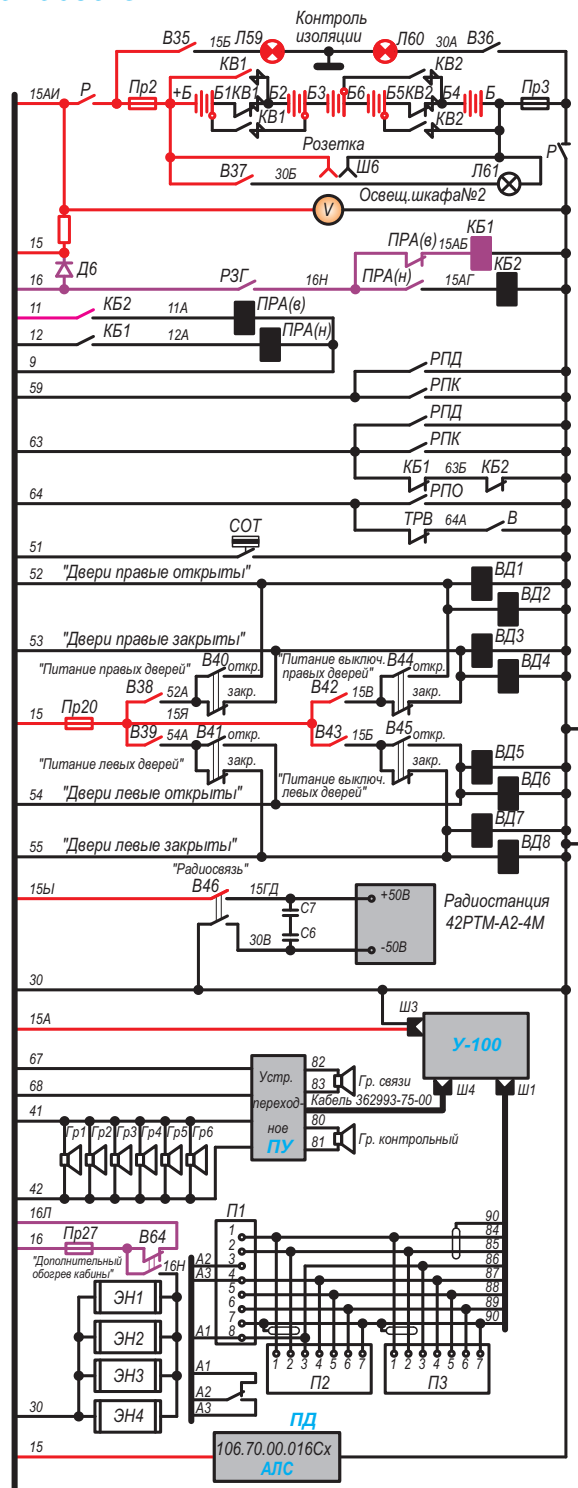






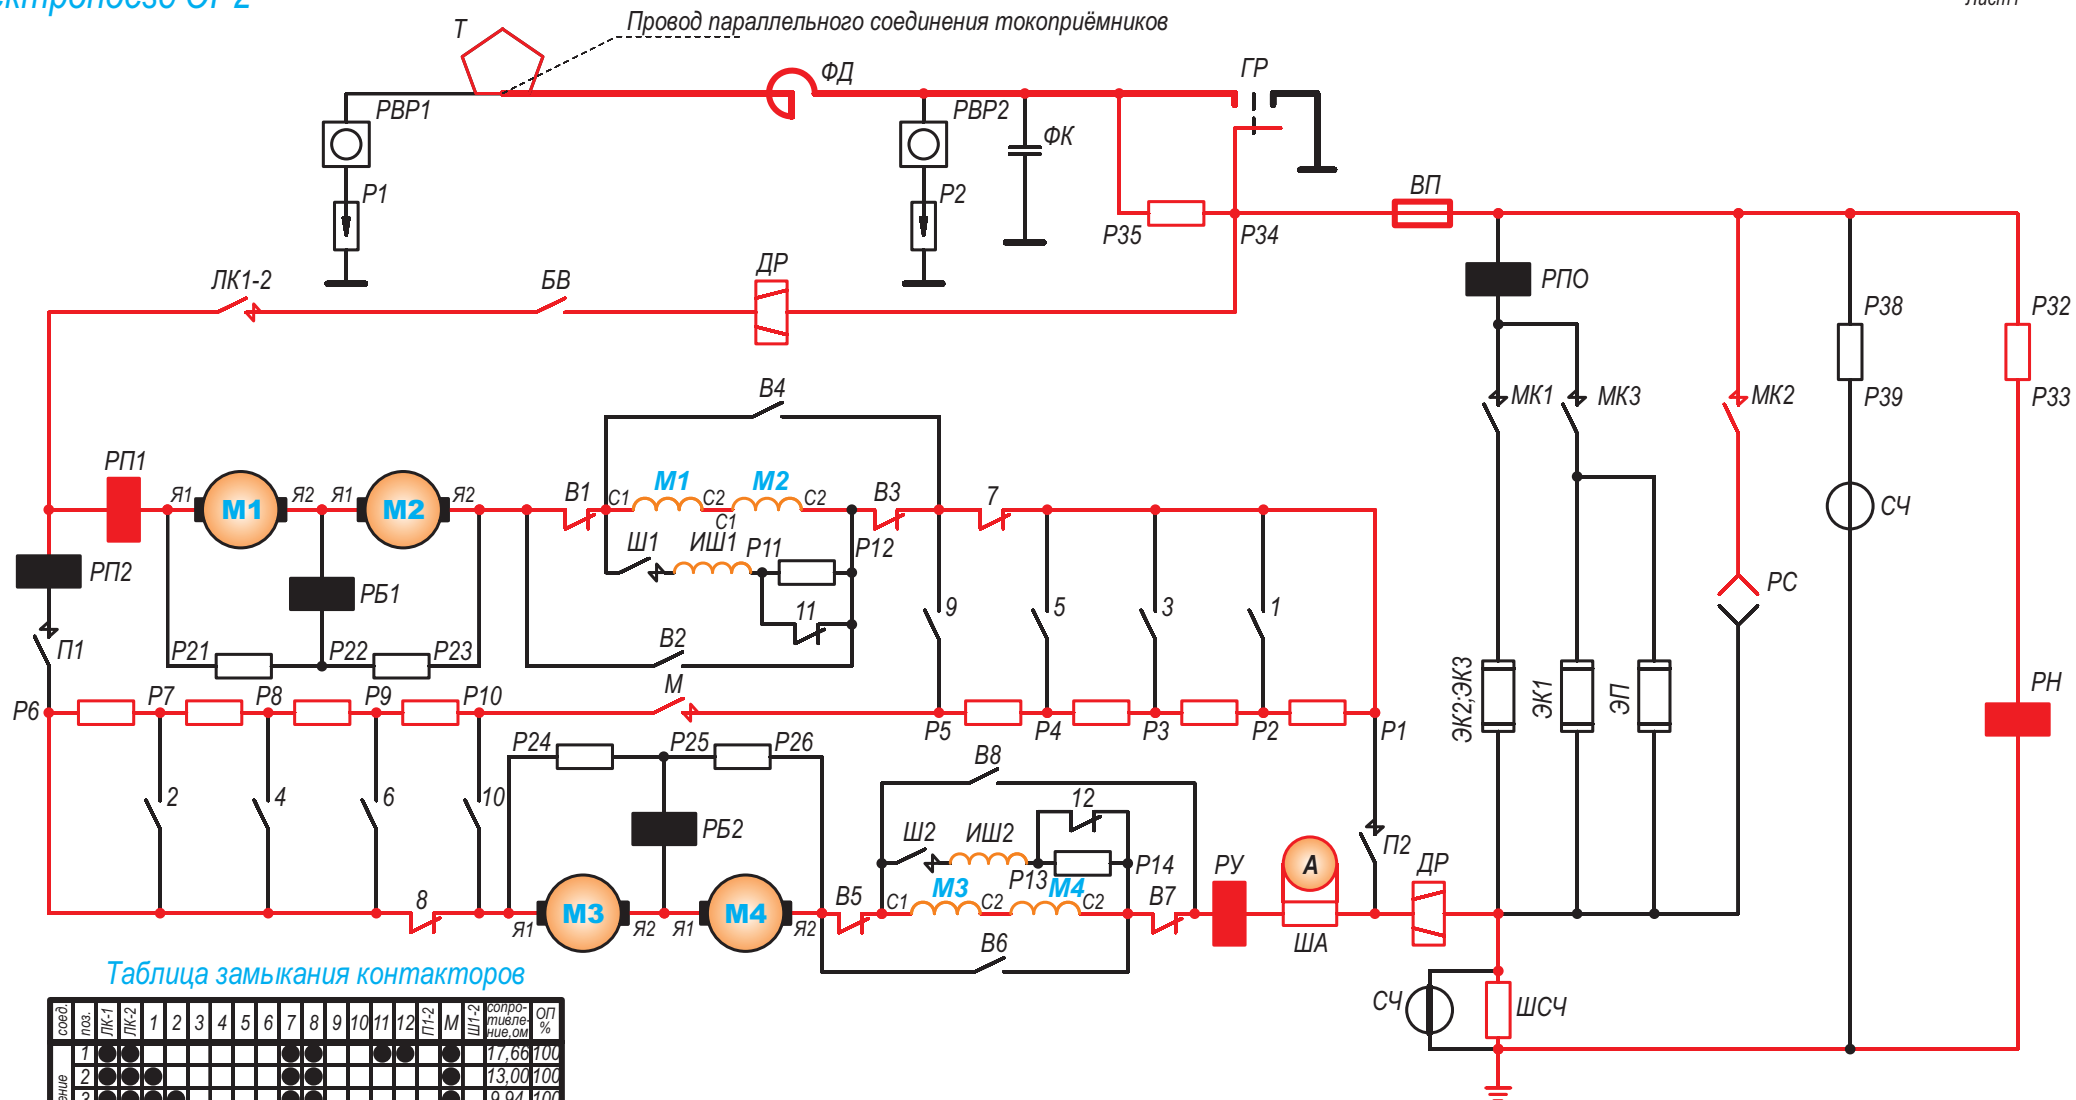


Таблица замыкания контакторов

соед	поз.	ЛК-1	ЛК-2	1	2	3	4	5	6	7	8	9	10	11	12	П1-2	М	Ш1-2	сопротив- ление, Ом	от- %
Последовательное соединение	1	●	●							●	●				●		●	17,66	100	
	2	●	●							●	●				●		●	13,00	100	
	3	●	●		●					●	●				●		●	9,94	100	
	4	●	●		●					●	●				●		●	8,10	100	
	5	●	●		●		●			●	●				●		●	6,26	100	
	6	●	●		●		●			●	●				●		●	4,60	100	
	7	●	●		●		●		●	●	●				●		●	2,94	100	
	8	●	●		●		●		●	●	●				●		●	1,47	100	
	9	●	●		●		●		●	●	●		●		●		●	0,00	100	
	10	●	●		●		●		●	●	●		●		●		●	0,00	67	
	11	●	●		●		●		●	●	●		●		●		●	0,00	50	
Параллельное соед.	12	●	●		●		●		●	●			●		●		●	8,83	50	
	13	●	●		●		●		●	●			●		●		●	4,97	100	
	14	●	●		●		●		●	●			●		●		●	3,13	100	
	15	●	●		●		●		●	●			●		●		●	1,47	100	
	16	●	●		●		●		●	●			●		●		●	0,00	100	
	17	●	●		●		●		●	●			●		●		●	0,00	67	
	18	●	●		●		●		●	●			●		●		●	0,00	50	

Схема принципиальная силовой цепи моторного вагона
электропоезда ЭР2 (№№1211-1330)

